

# MONUMENT RECORD

Corner I.D. #

R-34 R-10

STATE OF INDIANA - COUNTY OF MONROE



Section Fourteen (14), Township 9 North, Range 1 East

Monument Description & Remarks: Found Stone w/"X" at center of N-W 1/4.

Stone measures 4" x 10" x 6" out of ground. Corner witnessed 6/30/89.

(See attached notes)

## Recovery Tie Drawing

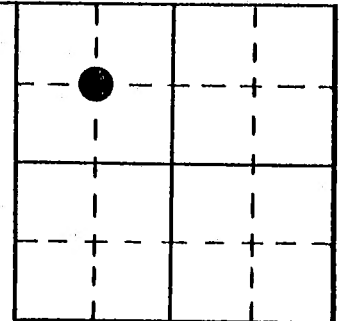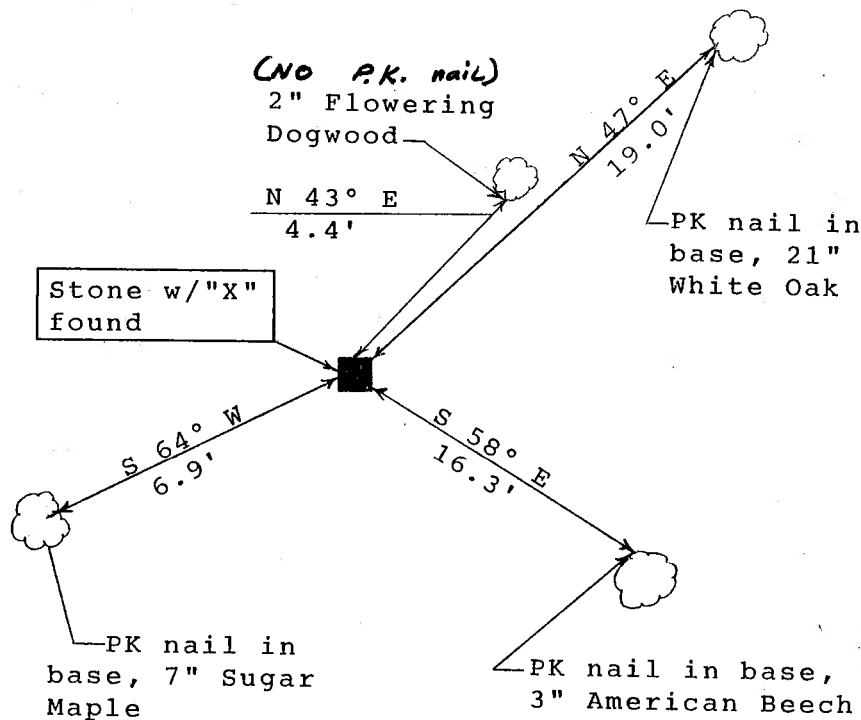

● At Corner



Not To Scale

State of Indiana

County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; and the above data is given under my hand and seal this 3rd day of February, 1995 A.D.

Space  
Reserved For  
Recording  
Officer

Indiana Registered Land Surveyor No. \_\_\_\_\_ or

Morgan-Monroe State Forest

United States Government Agency

Darrell Breedlove, Timber Specialist  
Title

Field Book:

n/a

Page:

n/a

SECTION 14, T9N, R1E

pe that sits  $4\frac{1}{2}'$  W of a pasture fence corner is 77.2' West of being on-line. A 1"x12" pipe that sits next to a pasture fence corner is 62.6' East at being on-line. Neither pipe was used to locate State Forest boundary.

d) On June 30, 1989, the center stone of the NW $\frac{1}{4}$  of Sec.14 was witnessed as follows: PK nails were driven at the bases of the first three trees.

	AZ	Spp.	DBH(in)	Distance(ft)	Comment
S 88° E	122° PK	American Beech	3	16.3	S 58° E
S 64° W	244 PK	Sugar Maple	7	6.9	S 64° W
N 47° E	047 PK	White Oak	21	19.0	N 47° E
N 43° E	043	Flowering Dogwood	2	4.4	N 43° E has yellow tag

EXPLANATION  
NEEDED

This stone has an "x" and measures 4"x10"x6"(h). It is NO. 25°W (1°W) from the SW corner of the E $\frac{1}{2}$ , NW $\frac{1}{4}$ , Sec. 14(see 3b). It is directly on-line between stones  $\frac{1}{4}$  mile North and  $\frac{1}{4}$  mile South of it (see 1 and 3b).

e) The NW corner, E $\frac{1}{2}$ , NW $\frac{1}{4}$  is NO. 25°W (1°W) from both a stone found  $\frac{1}{4}$  mile south of it (see 3d) and a stone found  $\frac{1}{2}$  mile South of it (see 3b). This corner stone was witnessed in 1987 (see 1).

f) A rebar pin was found 51' West of the SW corner stone, E $\frac{1}{2}$ , NW $\frac{1}{4}$ , Sec. 14. It apparently lines up with a fence running North from a  $\frac{1}{2}$ "x10" pipe found near the center of SW $\frac{1}{4}$  Sec. 14. This rebar pin was not used to locate the State Forest boundary.

g) A 1"x12" steel pipe with a  $\frac{1}{2}$ "x5 $\frac{1}{2}'$  steel rod inserted was found at the West  $\frac{1}{2}$  mile of Sec. 14. It is S 88.9°W (1°W) from the SW corner stone of the E $\frac{1}{2}$ , NW $\frac{1}{4}$ , Sec. 14 (see 3b).

h) On 1/26/90, The SE corner stone, SW $\frac{1}{4}$ , NE $\frac{1}{4}$ , Sec. 14 was witnessed as follows: PK nails were driven at the base of these trees.

AZ	Spp.	DBH(in)	Distance(ft)	Comment
150	Tulip Poplar	14	20.3	
104	Black Cherry	11	17.8	
356	Redbud	8	21.2	

A pinched pipe was driven next to the stone.

This stone has an "R" inscribed on its top and measures 4"x4"x2" h. It is N 89.0°E (1°W) from the SW corner, E $\frac{1}{2}$ , NW $\frac{1}{4}$ , Sec. 14 (see 3b). It sits just North of an intermittent stream crossing on the East side of Baby creek Rd.

i) A fence corner in a 10" Blackgum near the center of Sec. 14 appears to be 21' too far North. It was not used to locate the State Forest boundary.

j) A fence corner at the east  $\frac{1}{2}$ -mile of Sec. 14 is N 89.0° from the SE corner stone, SW $\frac{1}{4}$ , NE $\frac{1}{4}$ , Sec. 14(see 3h) agreeing closely with other evidence along the mid-section line. A  $\frac{3}{4}$ " rebar was found at the east  $\frac{1}{2}$  mile of Sec. 14, 17 ft. north of the fence corner. A  $\frac{3}{4}$ " rebar pin was found at the S  $\frac{1}{8}$ -mile, SE $\frac{1}{4}$ , NE $\frac{1}{4}$ , Sec. 14. Both pins have lathes marked 'Property Corner', and they are N88.2°E (1°W) from the stone at Baby Creek Rd.